


## PRESSURE MAPPING, FORCE MEASUREMENT, AND TACTILE SENSORS

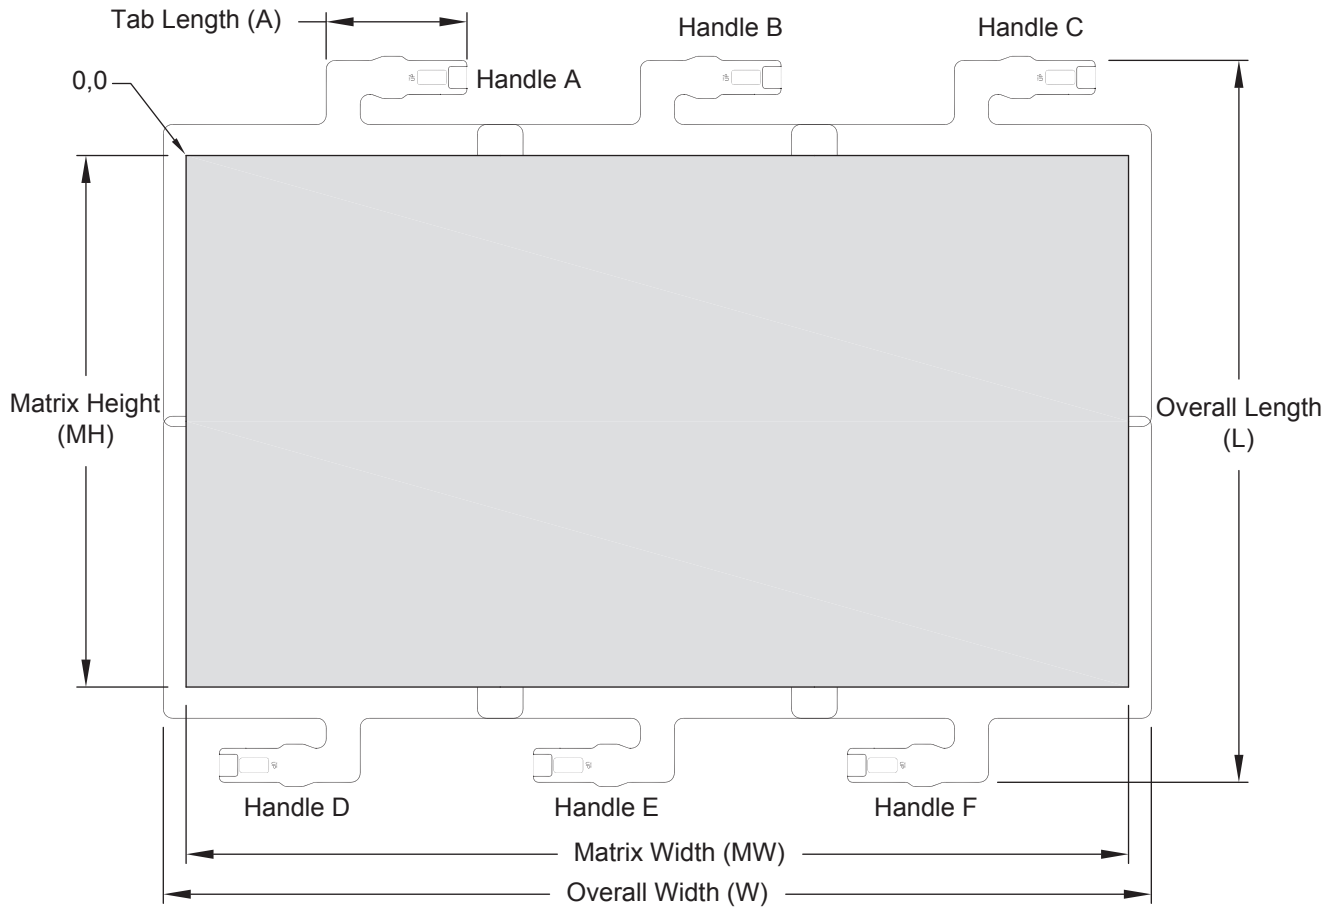

General Dimensions			Sensing Region Dimensions						Summary			
Overall Length <i>L</i>	Overall Width <i>W</i>	Tab Length <i>A</i>	Matrix Width <i>MW</i>	Matrix Height <i>MH</i>	Columns			Rows			Total No. of Sensels	Sensel Spatial Resolution
					<i>CW</i>	Pitch <i>CS</i>	<i>Qty.</i>	<i>RW</i>	Pitch <i>RS</i>	<i>Qty.</i>		
(mm)	(mm)	(mm)	(mm)	(mm)	(mm)	(mm)		(mm)	(mm)			(sensel per sq-cm)
1001.8	1370.8	195.1	1307.6	737.6	5.8	8.4	156	5.8	8.4	88	13,728	1.4
(in)	(in)	(in)	(in)	(in)	(in)	(in)		(in)	(in)			(sensel per sq-in)
39.44	53.97	7.68	51.48	29.04	0.230	0.330	156	0.230	0.330	88	13,728	9.2

### Pressure Ranges

kPa	862
psi	125